

MATSING[®]

LENS TECHNOLOGY ENABLED

MS-MBA-6.6.3-C4-H4-L2

Instruction Manual

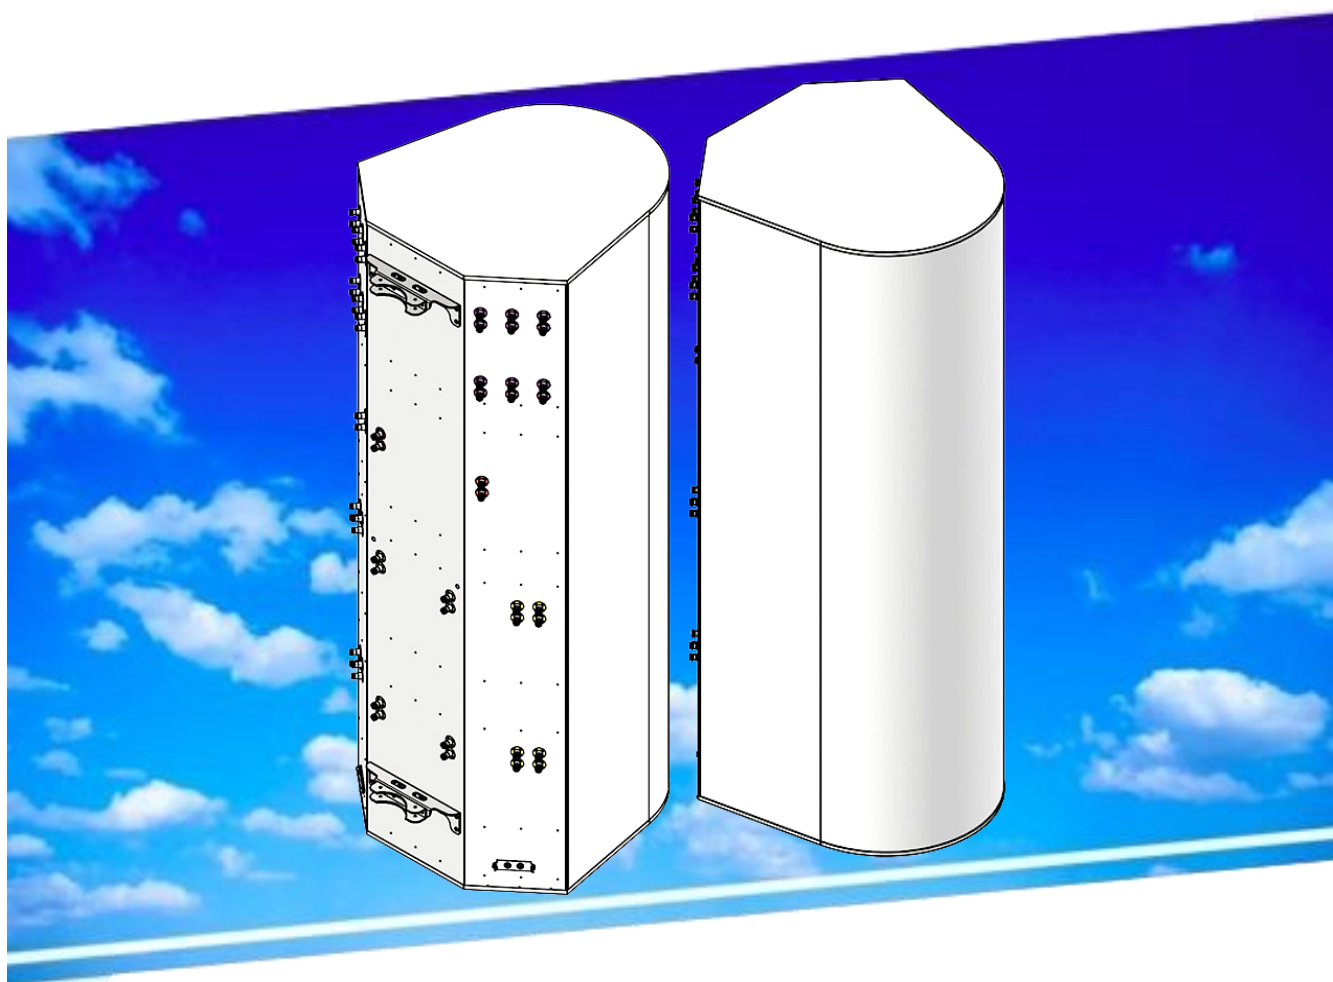


Table Of Contents

1.00 Pattern diagram

- 1.10 C-Band
 - 1.11 Horizontal pattern
 - 1.12 Vertical pattern
- 1.20 H-Band
 - 1.21 Horizontal pattern
 - 1.22 Vertical pattern
- 1.30 L-Band
 - 1.31 Horizontal pattern
 - 1.32 Vertical pattern

2.00 Beams and connectors

- 2.10 Plan view resultant beam layout
- 2.20 Connector port table
- 2.30 Connector detail
- 2.40 Connector layout

3.00 Bracket installation

- 3.10 Bolts and nuts / tools
 - 3.11 Bolt and nuts set
 - 3.12 Bracket
- 3.20 Tools requirement
- 3.30 Bracket spacing & installation guide


Revision History:

<u>Date</u>	<u>Description</u>	<u>Rev By</u>	<u>Check By</u>	<u>Rev no</u>
19-Feb-2025	Initial Release	RL	Pavel	0


1.00 Pattern diagram

1.10 C-Band

1.11 Horizontal pattern

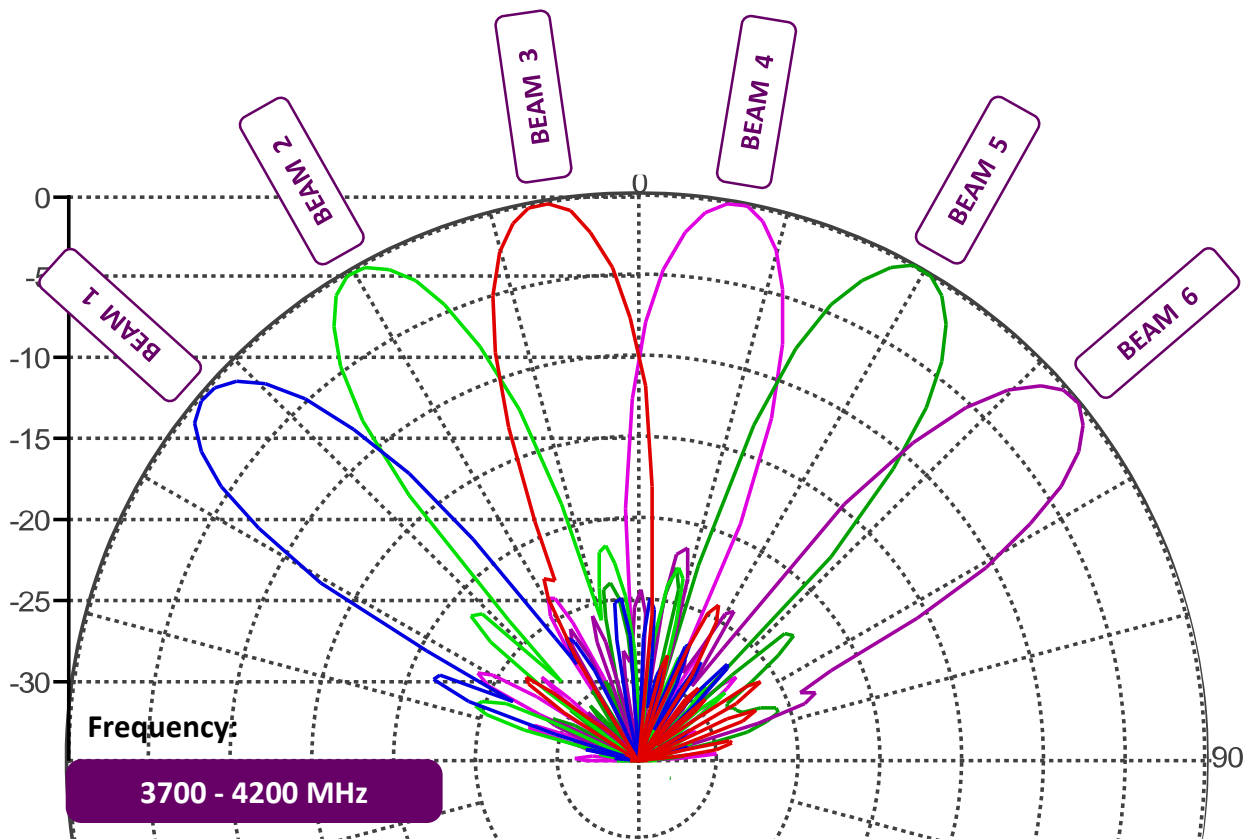


1.12 Vertical pattern

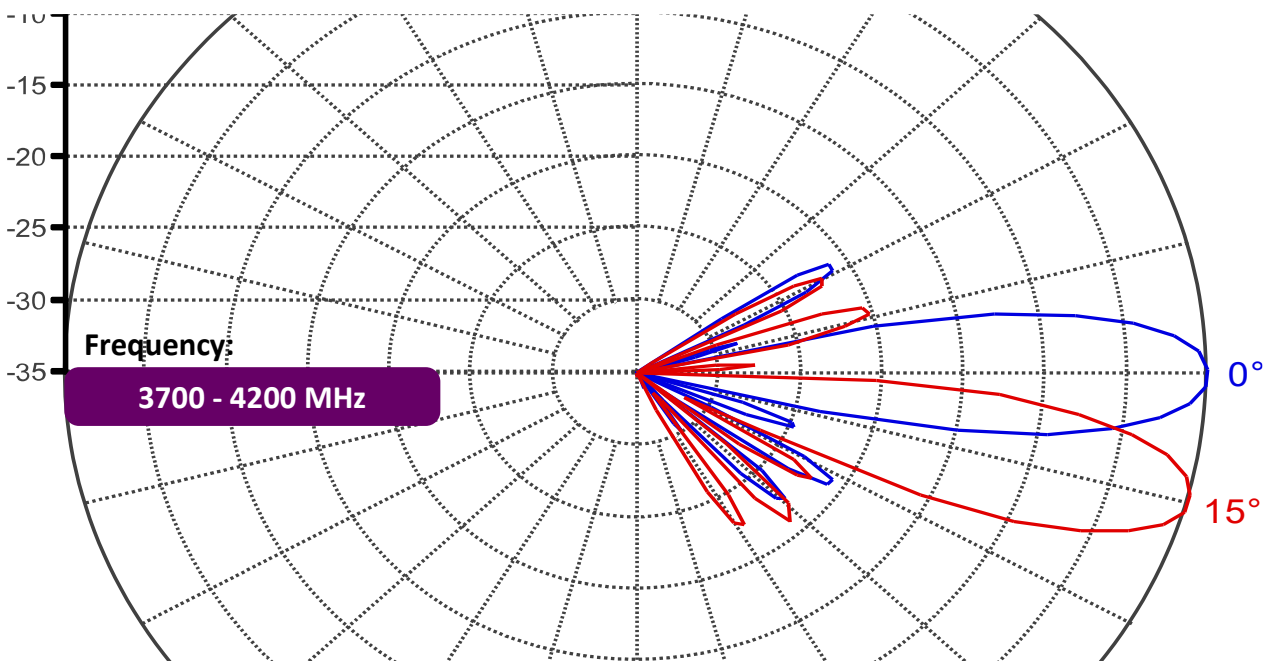


1.20 H-Band

1.21 Horizontal pattern

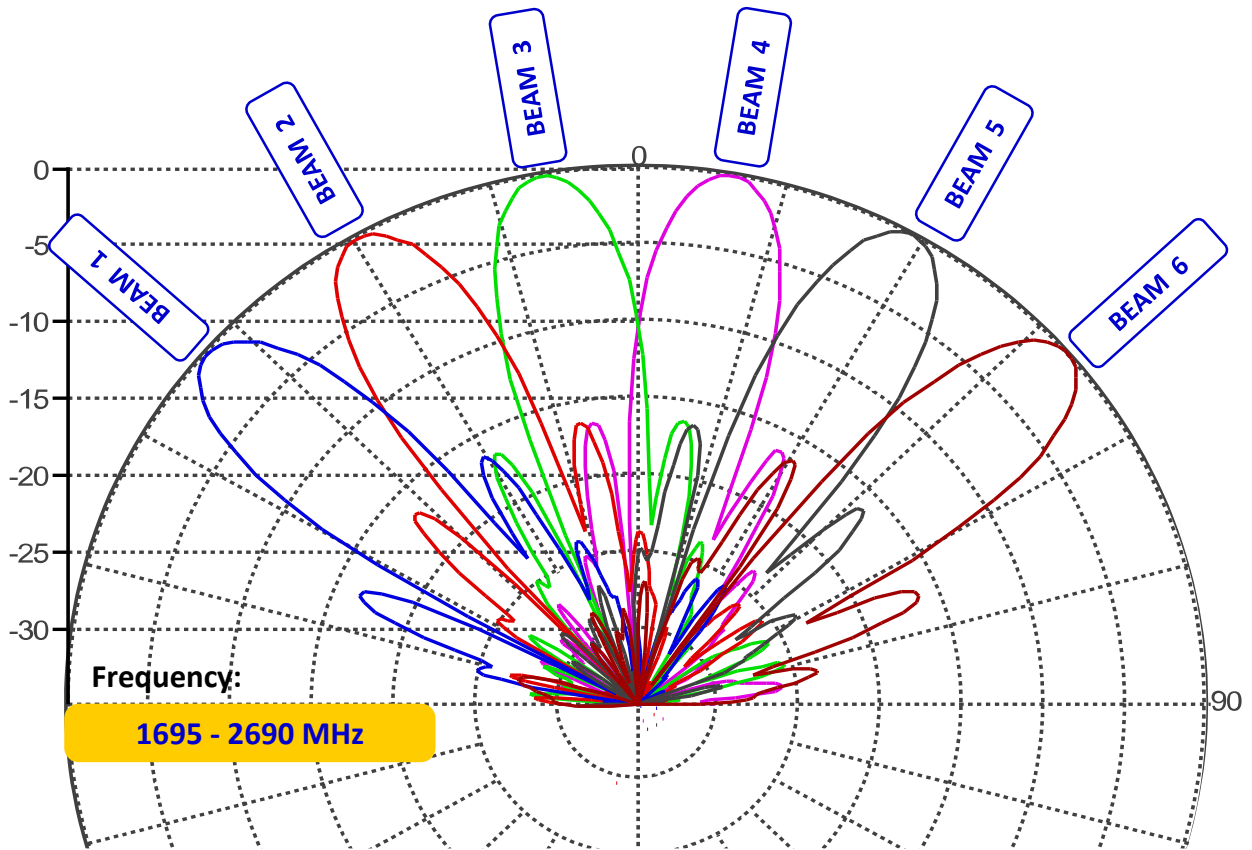


1.22 Vertical pattern

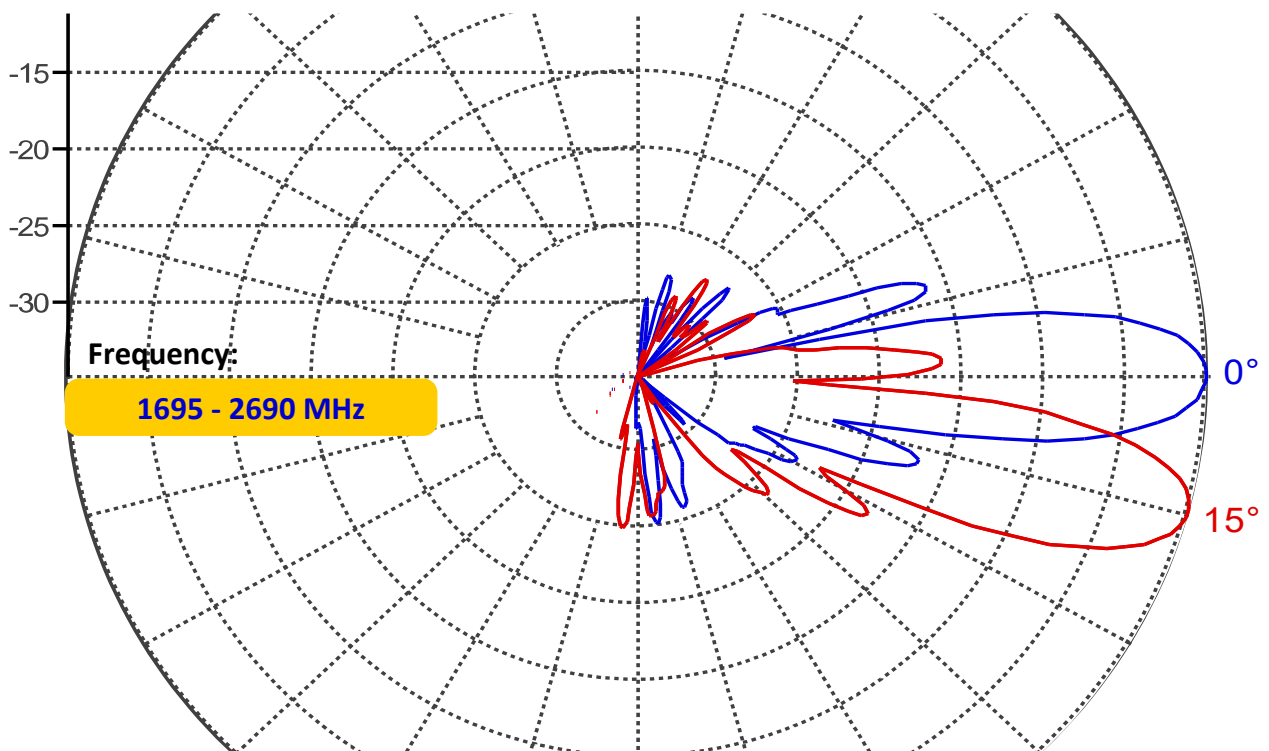


1.30 L-Band


1.31 Horizontal pattern

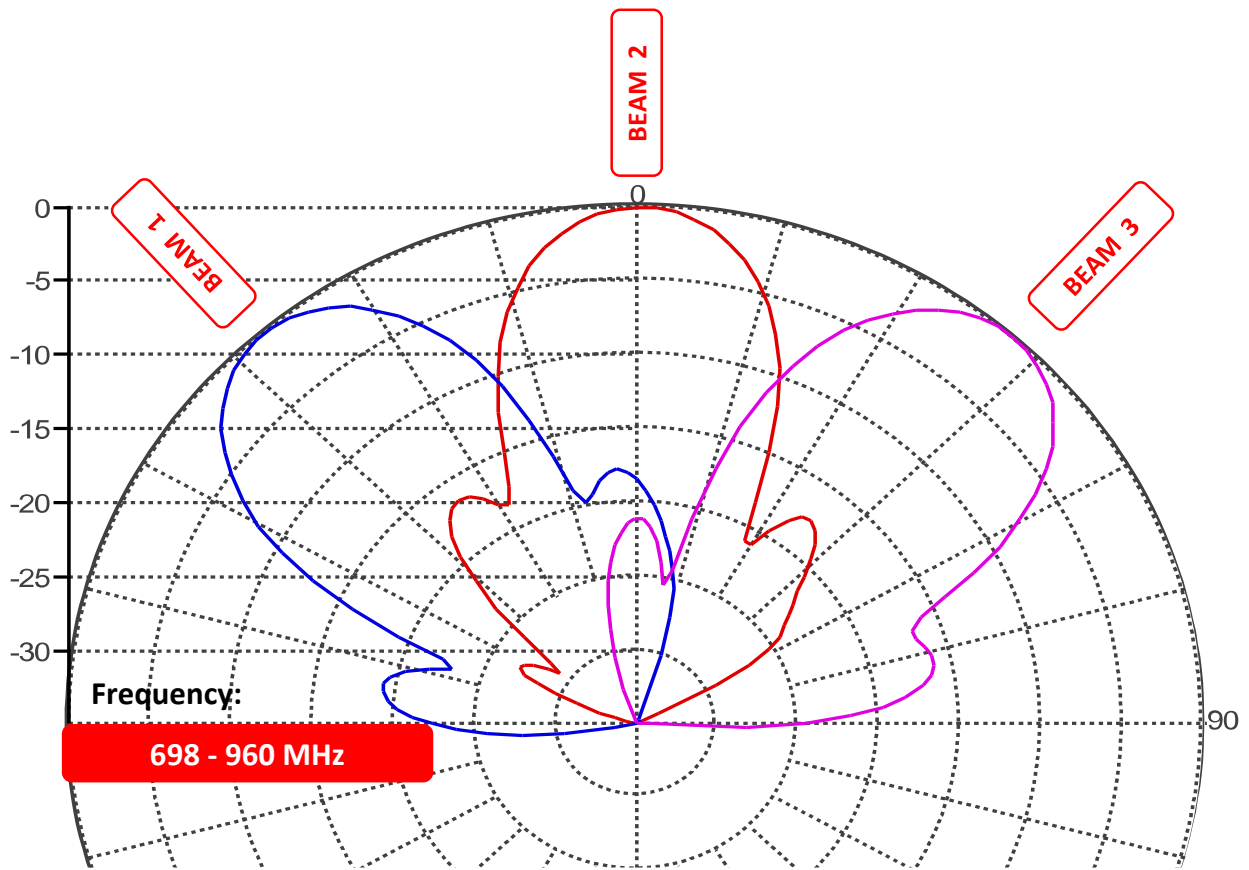

1.32 Vertical pattern

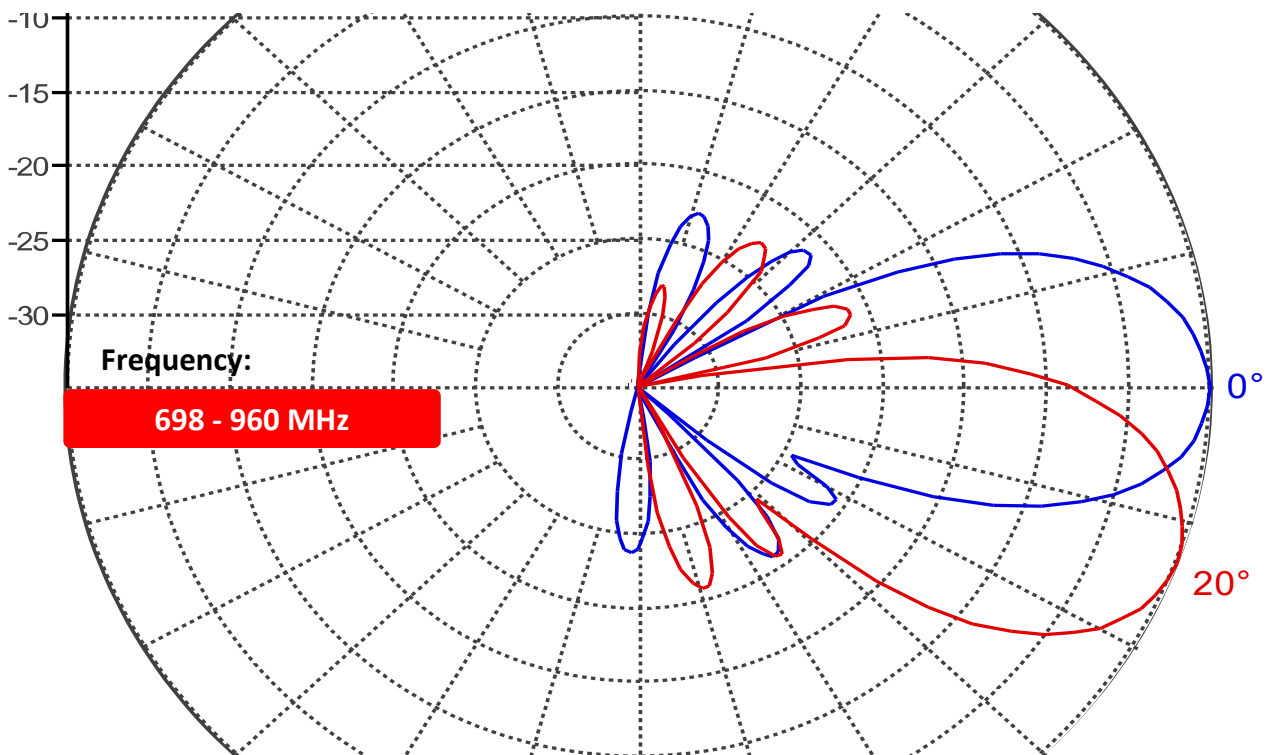

2.40 Connector layout

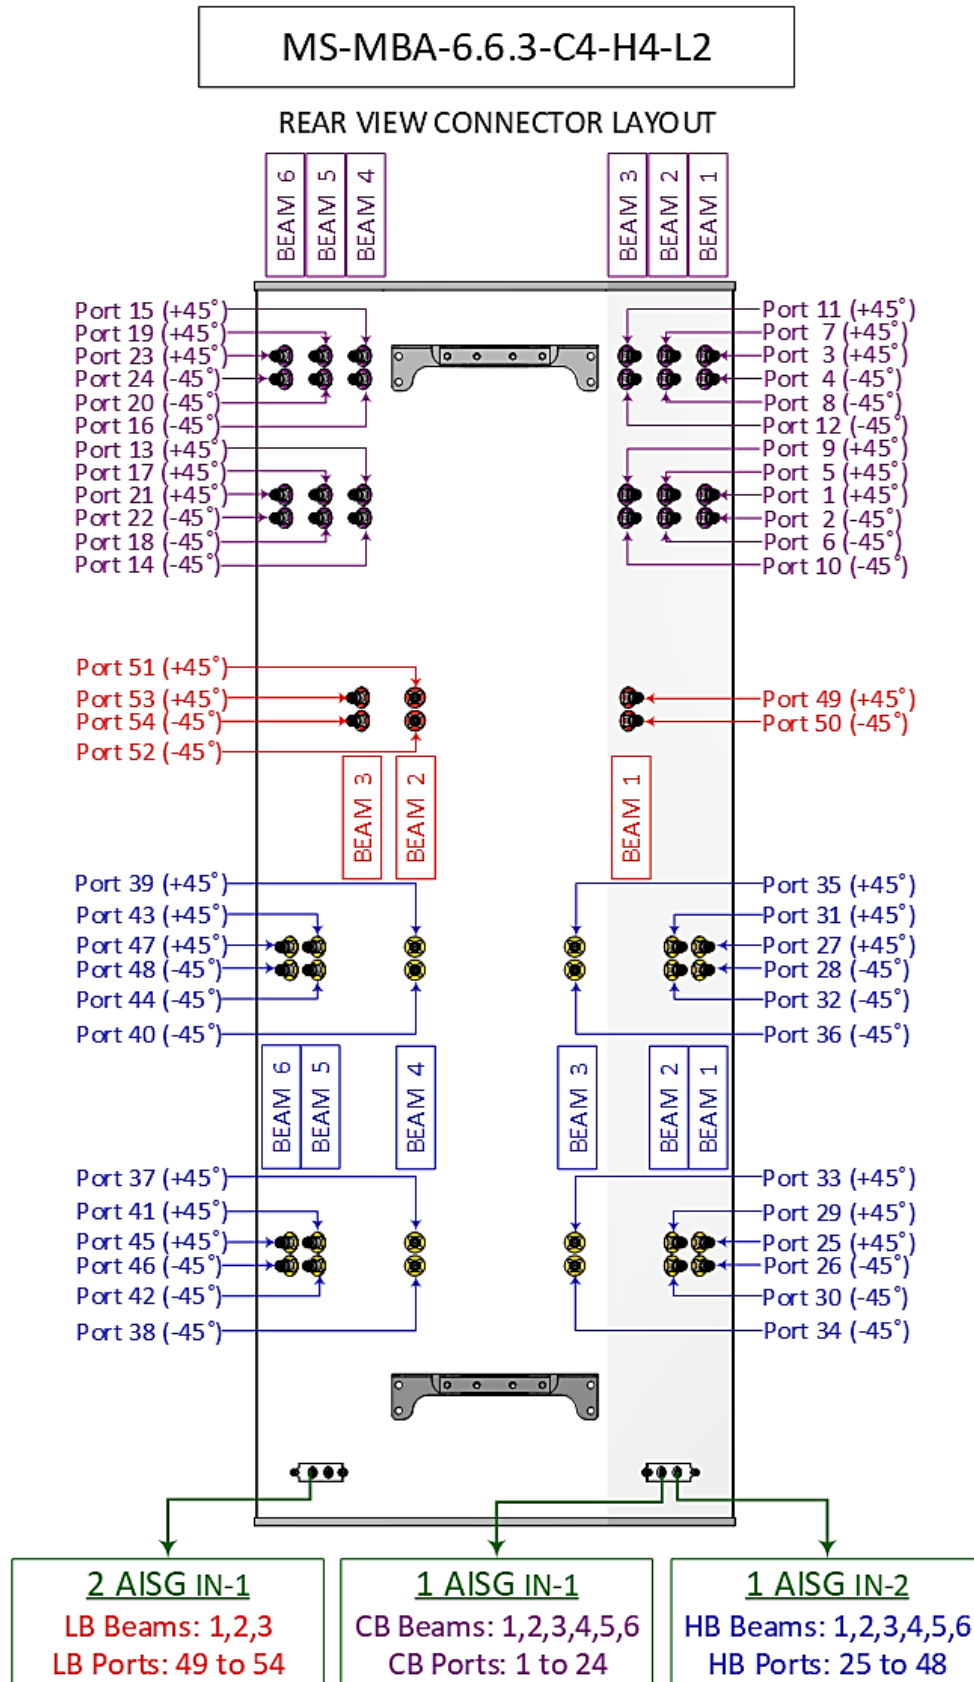

3.00 Bracket installation

3.10 Bolts and nuts / tools

Bracket	Bolts		Nuts	
Qty	Size	Qty	Size	Qty
2	M12 x 200mm	4	M12	10

3.11 Bolt and nuts set



3.20 Tools requirement


Adjustable spanner



M12 spanner



3.12 Bracket

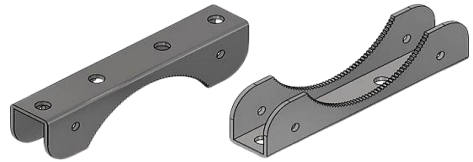

3.30 Bracket spacing & installation guide

